
APPLICATION CYCLES

CYCLE ON CYCLE ON CEMENT SUBSTRATE

AKRYLINE GG or GM or GF

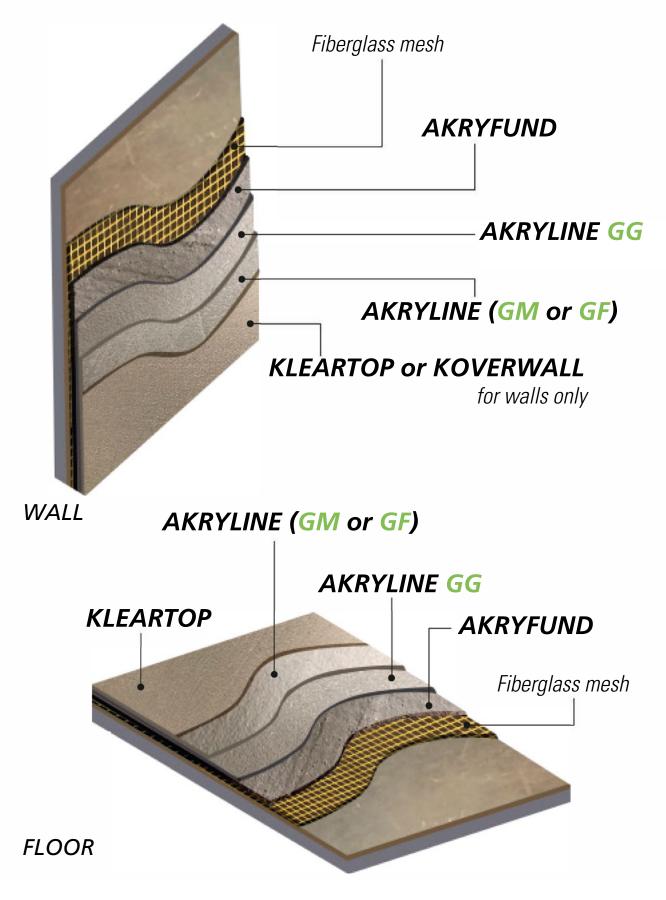

AKRYLINE

DAY 1

- Lay the first roll of fiberglass mesh over the perfectly clean, dry surface. Proceed by laying the following rolls adjacent to the previous ones, without overlapping and avoiding folds or creases in the mesh.
- Apply a coat of **AKRYFUND** by roller or by brush, distributing the product evenly and homogeneously on the surface. Allow to dry for 3 to 4 hours.
- Once completely dry, apply a coat of AKRYLINE GG (coarse grain) with either a metal or a plastic trowel, taking care to smooth-off all excess product.

DAY 2

- Sand the surface with 40-50 grit sandpaper and then vacuum clean the dust.
- Check the evenness of the surface and apply a coat of **AKRYLINE GM** (medium grain) with the use of a metal trowel taking care to smooth-off all excess product.
- Allow to dry for 4-6 hours.

NB: proceed with the following activities only if you also want to use **AKRYLINE GF** (fine grain), otherwise, go directly to the application of the **KLEARTOP** finish.

When completely dry, sand down the surface with 60-80 grit sandpaper and vacuum clean away the dust.
Check the evenness of the surface and apply a coat of **AKRYLINE GF** (fine grain) with the use of a metal trowel taking care to level off all excess product.

DAY₃

- Sand down the surface with 100-150 grit sandpaper and vacuum clean away the dust.
- Add all the required quantity of **CATALFIN** to the **KLEARTOP** product while stirring with a mechanical mixer. Continue mixing until the two components are perfectly emulsified. Manual mixing alone may not be sufficient to achieve perfect blending of the two components.
- The catalysis ratio is calculated by weight and not by volume, so if the entire package will not be used, weigh exact quantities with an electronic scale.

Catalysis ratio: KLEARTOP 100 + CATALFIN 20.

- Apply the first coat of KLEARTOP with a short pile roller, by brush or by airless spraying equipment and allow to dry for 4-6 hours.
- Apply the second coat of **KLEARTOP** by short pile roller, brush or airless spraying and allow to dry.
- For the **KLEARTOP 100** high gloss version, a third coat can be applied to increase the gloss of the surface.

IMPORTANT: in case more than 24 hours pass between coats, it will be necessary to sand the surface with 320 grit sandpaper.

NB: for wall applications, **KOVERWALL** can be used as an alternative to **KLEARTOP**. Being a singlecomponent product, it must not be catalyzed. The application steps to follow are the same as for **KLEARTOP**.